PROBLEM SYMPTOMS TABLE

DI1AP-08

Symptom	Suspect Area	See page
Immobiliser is not set. (Engine starts with key codes other than the registered key code.)	Engine and ECT ECU	IN-35
Engine does not start.	Key Wire harness Transponder key coil Amplifier Engine and ECT ECU	*1 IN-35 BE-175 - IN-35
Security indicator is always ON.	 Security indicator Wire harness Engine and ECT ECU 	IN-35 IN-35
Security indicator is always ON. (Although code has been registered in the automatic registration mode, indicator is not OFF.)	Wire harness Transponder key coil Amplifier Engine and ECT ECU	IN-35 BE-175 - IN-35
Security indicator is OFF. (When DTC of immobiliser is output)	Wire harness Transponder key coil Amplifier Engine and ECT ECU	IN-35 BE-175 - IN-35
Security indicator is OFF. (When DTC of immobiliser is not output)	Wire harness Engine and ECT ECU	IN-35 IN-35
Security indicator is abnormally blinking.	Wire harness Engine and ECT ECU	IN-35 IN-35

^{*1 :} Check that the key which did not start the engine has been registered and that it is possible to start with other already registered key.

^{*2 :} Finish the automatic registration mode because the mode might still remain.