

**25. Navigation system cannot be operated with voice recognition.****INSPECTION PROCEDURE****1 Check microphone.****NG****Replace microphone (See page IN-38).****OK****2 Check overhead J/B.****NG****Replace overhead J/B (See page IN-38).****OK****3 Check wire harness between overhead J/B (microphone) and navigation ECU.****PREPARATION:**

Disconnect the overhead J/B and navigation ECU connectors.

**CHECK:**

Check continuity of the wire harness between terminals of the overhead J/B and those of the navigation ECU0.

**OK:****Continuity****NG****Replace or repair wire harness or connector.****OK****Check and replace navigation ECU.**