


INSPECTION


INSPECT MAGNET SWITCH NO. 1

- (a) Push in the plunger and release it. Check that it returns quickly to its original position.

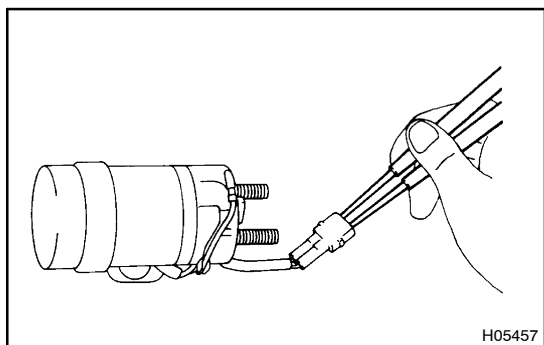

- (b) Using an ohmmeter, measure the resistance between connector terminals.

Resistance: Approx. 7 Ω

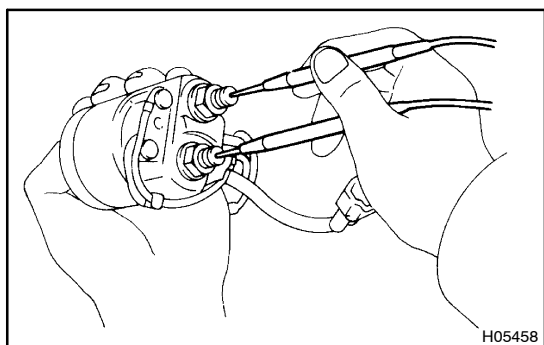

- (c) Using an ohmmeter, check for no continuity between the terminals with the plunger released.